

# Technical Service Bulletin No. 27

**Created by: Lab.gruppen AB Service Department**

**Date: 2011-10-11**

**Reference no: C12**

It is highly recommended to implement this service bulletin as preventative maintenance if the unit is serviced for another issue.

## Affected models

FP+.

C16:4, C28:4, C48:4, C68:4, C88:4.

PLM10000Q, PLM14000.

## Affected boards/modules

SP100FXXx-FXX

SP130FXXx-FXX

SP140F01a-FXX, SP140F01b-FXX

## Symptom


Screaming sound from power supply if amplifier powers up.

Amplifier does not power up.

## Solution

Replace capacitor C12 with either of below listed components.

Lab Part No.	Description	Amount	Info	Pos
6n8250VMMK5	Wima: FKS2 6800PF 10% 400VDC	1		C12
6n8250VMMK5	Epcos: B32529-C3682-K289	1		C12

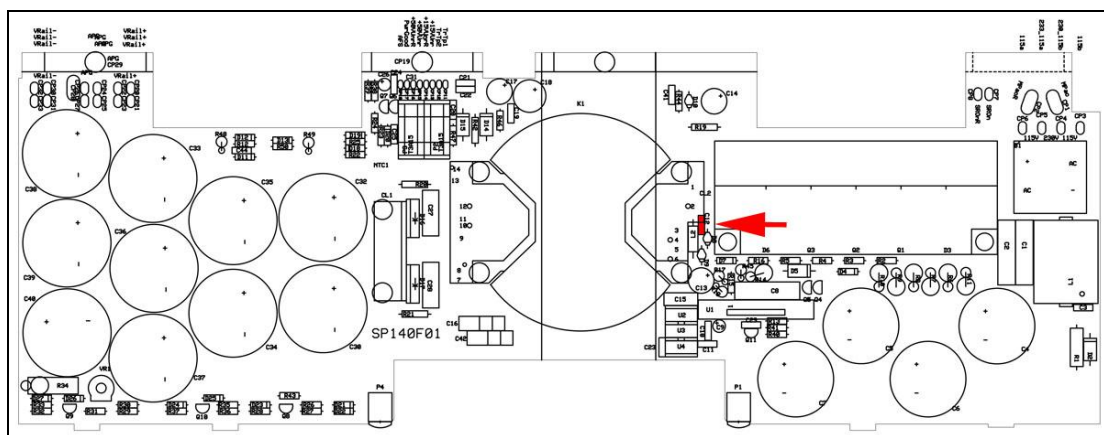

## ***Service Log Information***

Write “Technical Service Bulletin no.27” in column “Repair Remedy” besides other normal repair information.

## ***History***

Date	Created By	Status	Bulletin no.	Comment
2011-10-11	CL	SHARP	27	C12