

# TECHNICAL BULLETIN




*MODEL/DERIVATIVE:*  
**Freelander**

*Bulletin N°:* **0012**  
*CDS. ref:* **L8666bu**  
*Issue:* **1**  
*Date:* **12.12.01**

*AFFECTED RANGE:*  
**All vehicles to VIN 1A 576764**

*PROBLEM:*  
**REAR BRAKE SHOES STICKING ON**  
**When the handbrake is released the rear brake shoes may stick to the brake drum.**

*CAUSE:*  
**Under certain conditions the brake shoe bonding material may cause the shoe to stick to the brake drum.**

*ACTION:*  
**Where a customer complaint of the above is confirmed, replace the rear brake shoes set with a new specification set, now available from Land Rover Parts. Refer to Workshop Manual, Brakes, repair number 70.40.09. For additional information on refitting the brake drum, refer to Technical Bulletin  0003.**

*PARTS INFORMATION:*  
**SFS000060 - Rear brake shoes - set**

*WARRANTY CLAIMS:*  
**Use Complaint Code: 6F2F**

**Use S.R.O.: 70.40.09 - shoes - rear set - renew - includes handbrake adjust**  
**Time allowance: 1.50 Hrs**

**Please return discarded parts to Land Rover.**