

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Defender

Bulletin N°: 0081
CDS. ref: L8708
Issue: 1
Date: 31.10.01

AFFECTED RANGE:
All vehicles up to VIN 2A 622424


PROBLEM:
FRESH AIR VENT - WATER / DUST INGRESS AND DIFFICULT TO CLOSE

- Water or dust ingress into vehicle through fresh air vent seal.
- Fresh air vent difficult to close.

CAUSE:
Failure of fresh air vent seal material.

ACTION:
Where a complaint of the above is confirmed, follow the procedure below to replace the fresh air vent seal with the improved seal detailed in *PARTS INFORMATION*.

1. Fully open fresh air vent.
2. Remove 2 bolts securing the fresh air vent control arm to fresh air vent.
3. Remove nuts securing hinge pins, release pins and remove the fresh air vent.
4. Carefully remove and discard seal, clean surface to remove any remaining adhesive.
5. Remove backing from the new fresh air vent seal and carefully align it to the edges of the fresh air vent, (inset in illustration 1), press seal firmly home.
6. Align fresh air vent to fresh air vent control arm and finger tighten bolts.
7. Lubricate hinge pins, align fresh air vent to hinges, fit pins and tighten nuts to 6 Nm.
8. If paint finish on nuts is damaged repair as required.
9. Tighten fresh air vent control arm bolts to 10 Nm.
10. Close fresh air vent.

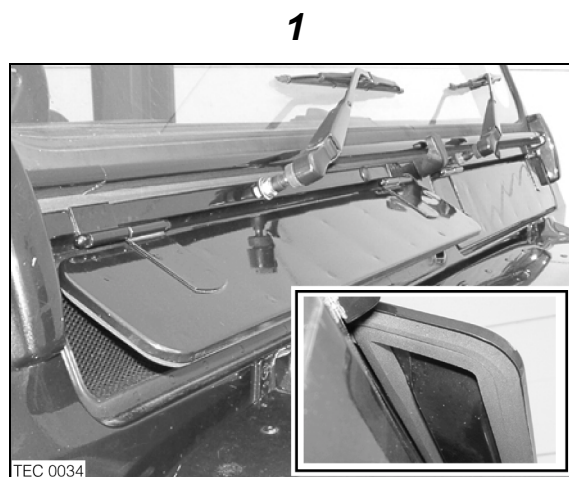

PARTS INFORMATION:

JAE000030 – Fresh air vent seal

WARRANTY CLAIMS:

Use Complaint Code: 8M9N

Use S.R.O.: 80.15.19

Time allowance: 0.30 Hrs

Please do not return discarded parts to Land Rover.