

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Range Rover

Bulletin N°: 0006
CDS. ref: L8651bu
Issue: 1
Date: 02.05.01

AFFECTED RANGE:

All 2.5 diesel derivatives with Exhaust
Gas Recirculation (EGR) in VIN range: WA 403804 to 1A 446851

PROBLEM:

COOLANT LEAKAGE - FAILURE OF TOP OR BOTTOM HOSE

CAUSE:

Hose material degradation.

ACTION:

Hoses manufactured from a new material were introduced at VIN 1A 448582.

In all cases of either top or bottom hose failure on vehicles within the above VIN range, replace **BOTH** hoses with the latest specification components as detailed in *PARTS INFORMATION*.

NOTE: This action applies **ONLY** to vehicles with EGR.

PARTS INFORMATION:

PCH124730 Hose - radiator top

PCH124720 Hose - radiator bottom

WARRANTY CLAIMS:

Use Complaint Code 2E1N - Top hose failure
as appropriate: 2E2N - Bottom hose failure

Use S.R.O.: 26.30.89/64 Top hose and bottom hose - renew
Time allowance: 0.70Hrs