

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Freelander

Bulletin N°: 0029
CDS. ref: L8618bu
Issue: 1
Date: 27.09.2000

AFFECTED RANGE:
All 2001 Model Year K1.8 and KV6 petrol derivatives, (VIN 1A 576764 onwards).


PROBLEM:
HILL DESCENT CONTROL (HDC) WARNING LIGHT ILLUMINATED - THROTTLE CABLE
The customer complains that the amber HDC warning light is illuminating.

CAUSE:
Insufficient free play in throttle cable.

ACTION:

Upon customer complaint of the amber HDC light on, or when carrying out any throttle cable related repair, refer to the procedure below to ensure correct setting of the throttle cable free play.

- Refer to Workshop Manual repair number [19.20.05](#), K1.8 or KV6 section as appropriate, for the adjustment procedure.
- On completion, check free play at the accelerator pedal pad. A free play of $12 \pm 1\text{mm}$ is required. If necessary, readjust the cable until this is achieved.
- Should the warning light remain illuminated after the ignition has been turned off and on, use TestBook to remove any fault codes stored in the ECU and to extinguish the warning light.

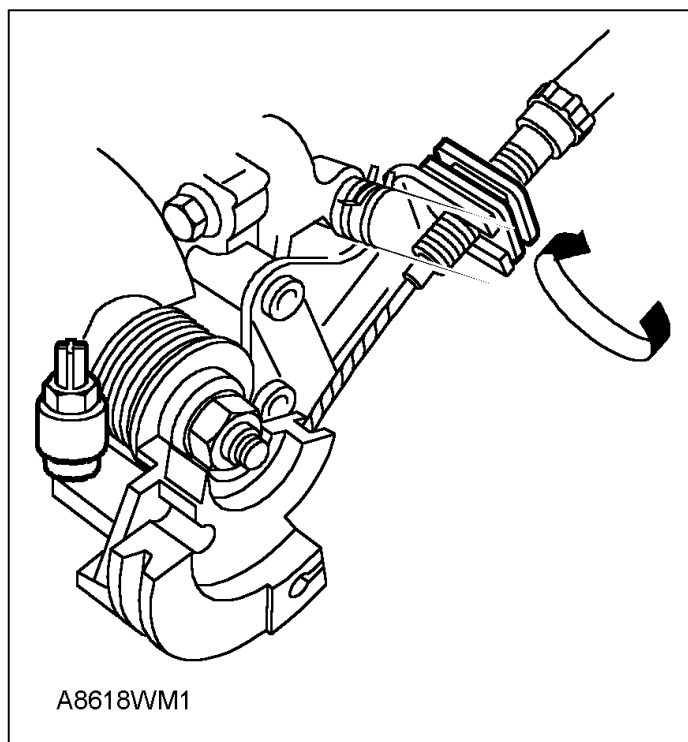

PARTS INFORMATION:
Not applicable

WARRANTY CLAIMS:

Use Complaint Code: 2K5A

Use S.R.O.: 19.20.05 Throttle cable - check and adjust

Time allowance: 0.20Hrs - K1.8

0.30Hrs - KV6

Use S.R.O.: 18.90.40/01 TestBook diagnosis (if required)

Time allowance: 0.50Hrs - All derivatives