

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Freelander

Bulletin N°: 0016
CDS. ref: L8619bu
Issue: 1
Date: 01.11.2000

AFFECTED RANGE:

All petrol derivatives in VIN ranges WA 600000 to 699999 and YA 500000 to YA 576763

PROBLEM:

FLUID LEAKAGE FROM PAS FLUID RESERVOIR

A customer complaint of fluid leakage is confirmed to originate from the base of the Power Assisted Steering (PAS) fluid reservoir.

CAUSE:

PAS fluid leak at the reservoir to low pressure hose connection.

ACTION:

Replace the PAS fluid reservoir and low pressure hose clip with the modified parts detailed in *PARTS INFORMATION*.

- Position container to collect fluid.
- Clean area around hose connections, release clips and disconnect hoses.
- Release reservoir from mounting bracket.
- Fit new reservoir QFX100252 to bracket.
- Connect hoses, using new clip PYC101220L on the low pressure hose connection, (arrowed in illustration).
- Top up and bleed system, Workshop Manual repair number [57.15.02](#) refers.



PARTS INFORMATION:

Old Part No	Description	New Part No
QFX100251	Reservoir - PAS fluid	QFX100252
QYC100240	Hose clip - low pressure	PYC101220L

WARRANTY CLAIMS:

Use Complaint Code: 5G5N

**Use S.R.O.: 57.15.08 Reservoir - PAS - renew
Time allowance: 0.30Hrs**

Time allowance includes bleed system