

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Discovery Series II

Bulletin N°: 0005
CDS. ref: L8630bu
Issue: 1
Date: 13.12.2000

AFFECTED RANGE:

All derivatives in VIN ranges: XA900000 to XA907214
XA200000 to 1A299999
1A700000 to 1A707662

PROBLEM:

COOLANT LEAKAGE - RADIATOR

A customer complaint of coolant leakage is confirmed to originate from the cooling system radiator.

CAUSE:

Fatigue failure of the radiator tubes due to thermal expansion and contraction of the radiator.

ACTION:

At VIN 1A 707662 a radiator produced from new high strength material was introduced.

Where coolant loss from the radiator is confirmed, replace with the new radiator which is now available from Land Rover Parts. Refer to *PARTS INFORMATION* for correct derivative application.

For repair procedure, refer to Workshop Manual repair number [26.40.01](#).

PARTS INFORMATION:

Old Part No	Application	New Part No
PCC107270	All Td5	PCC000640
PCC107260	All V8 except North America	PCC000650
PCC107260	V8 North America - up to VIN YA 290758	PCC000650
PCC107950	V8 North America - from VIN 1A 290759	PCC000710

WARRANTY CLAIMS:

Use Complaint Code: 2C5N

Use S.R.O.: 26.40.01

**Time allowance: Td5 diesel - 2.10Hrs
V8 petrol - 2.00Hrs**

NOTE: Normal Warranty Policy and Procedures apply.