

# TECHNICAL BULLETIN



**MODEL/DERIVATIVE:**

**Freelander**

**Bulletin N°: 0069**  
**CDS. ref: L8652bu**  
**Issue: 1**  
**Date: 23.05.01**

**AFFECTED RANGE:**

**All 2001 Model Year**                    **1A 5767654 to 1A 599999**  
**derivatives in VIN ranges:**    **1A 300000 to 1A 315095**

**PROBLEM:**

**INVOLUNTARY OPERATION OF TAILDOOR GLASS - CENTRAL CONTROL UNIT (CCU).**


The taildoor glass moves to the fully lowered position without driver intervention, while the vehicle is parked with the ignition turned **OFF**.

**CAUSE:**

This is a rare condition which can occur due to a software error within the CCU resulting in a susceptibility to external interference.

**ACTION:**

Where the customer describes a taildoor glass having operated as described above:

- Confirm initially that the window drop facility, which is a feature operated from the remote handset, has not been used accidentally.
- On 3 door Hardback derivatives only, confirm satisfactory electrical and mechanical operation of the 'roof off' micro switch. Refer to Technical Bulletin  0036 for details of the micro switch setting procedure.
- Where satisfied that none of the above conditions apply, replace the CCU with revised unit YWC000031. Refer to Workshop Manual repair number 86.55.75 for replacement procedure.
- Programme the replacement CCU to market requirements using T4/TestBook.

**PARTS INFORMATION:**

Old Part Number	Description	New Part number
YWC000030	Central Control Unit	YWC000031

*WARRANTY CLAIMS:*

**Use Complaint Code: 6U4Y**

**Use S.R.O.: 86.55.75 - Central control unit - renew**

**Time allowance: 0.40Hrs**

**Use S.R.O.: 86.90.57/01 - Programme with T4/TestBook**

**Time allowance: 0.20Hrs**