

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Discovery Series II

Bulletin N°: **0088**
CDS. ref: **L8686bu**
Issue: **1**
Date: **09.01.02**

AFFECTED RANGE:

All derivatives fitted with sub woofers up to VIN 2A 736340

PROBLEM:

TAIL DOOR VIBRATION

The tail door trim casing vibrates when the radio is operated at medium to high volume levels.

CAUSE:

Insufficient bonding between mating parts of the trim casing.

ACTION:

Where a complaint of the above is confirmed, replace the tail door trim casing with the new casing now available from Land Rover Parts.

Replace the tail door trim casing, refer to Workshop Manual, part number VDR100090, Doors, Trim Casing - Tail Door, repair number 76.34.09.99.

PARTS INFORMATION:

ESN000230LPW - Tail door trim casing - 5 seat - dark smokestone

ESN000230SUC - Tail door trim casing - 5 seat - bahama beige

ESN000240LPW - Tail door trim casing - 7 seat - dark smokestone

ESN000240SUC - Tail door trim casing - 7 seat - bahama beige

WARRANTY CLAIMS:

Use Complaint Code: 8C6W

Use S.R.O.: 76.34.09

Time allowance: 0.60 Hrs

Please return discarded parts to Land Rover.