TECHNICAL BULLETIN



MODEL/DERIVATIVE: Discovery Series II (LT) Defender (LD)
 Bulletin N°:
 0003

 CDS. ref:
 L8705bu

 Issue:
 1

 Date:
 27.02.02

AFFECTED RANGE: All Td5 derivatives up to VIN: Discovery 2A 741286 Defender 2A 626727

PROBLEM:

EXHAUST FRONT PIPE NOISE / VIBRATION A noise / vibration may be experienced at approximately 1200 rev/min.

CAUSE:

Internal separation of front pipe flexible hose.

ACTION:

Where a complaint of the above is confirmed, replace the exhaust front pipe with the new front pipe now available from Land Rover Parts.

Refer to Workshop Manual, Manifold and Exhaust System Td5, repair number 30.10.09.

PARTS INFORMATION: WCD000960 - Exhaust front pipe (Td5)

WARRANTY CLAIMS: Use Complaint Code: 2S3K

Use S.R.O.: 30.10.09

<u>Discovery</u> Time allowance: 1.20 Hrs

<u>Defender</u> Time allowance: 1.30 Hrs

Please return discarded parts to Land Rover.