

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Defender 02 MY

Bulletin N°: **0042**
CDS. ref: **L8713bu**
Issue: **1**
Date: **24.10.01**

AFFECTED RANGE:
All 02 MY vehicles with Central Door Locking (CDL)

PROBLEM:
FASCIA IMPACT CAUSES INERTIA SWITCH TO TRIP, RESULTING IN HAZARD WARNING LIGHTS FLASHING AND DOORS UNLOCKING

CAUSE:
The inertia switch in the fascia, (fitted to Defender 02 MY vehicles with CDL), unlocks the doors and activates the hazard warning lights in the event of an accident. This is a sensitive system and can be activated if there is an impact to the fascia.

- The system can only be activated when ignition switch is in position II or when the engine is running.
- The system will not stop the engine, this is controlled by a separate switch.

ACTION:
If the inertia switch has been activated due to an impact on the fascia, reset the system using the following procedure:

Reset procedure

1. Turn the ignition off - on - off, this will turn the hazard warning lights off.
2. Wait 5 minutes then turn the ignition on - off, this will reactivate the CDL.

In the unlikely event, a customer complaint of the above is confirmed, the customer should be informed there is no fault with the vehicle and advised of the reset procedure.

PARTS INFORMATION:
Not applicable

WARRANTY CLAIMS:
Not applicable