

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Defender

Bulletin N°: 0082
CDS. ref: L8721bu
Issue: 1
Date: 14.11.01

AFFECTED RANGE:

All vehicles in VIN range 1A 60000 to 1A 624000

PROBLEM:

NOISE / CREAK FROM THE FRONT SEAT

When a front seat is moved, a noise / creak can be heard in the cushion to squab area.


CAUSE:

The tension bar on the front seat squab, rubs on the cushion side plate.

ACTION:

Where a complaint of the above is confirmed, follow the rectification procedure below.

1. Remove seat cushion to allow access to the seat squab tension bar.
2. Using a suitable screwdriver, (arrowed 'A' in illustration 1), bend the tension bar (arrowed 'B' in illustration 1) away from the cushion side plate to create a minimum clearance of 2 mm (arrowed 'C' in illustration 1). If needed, bend the side plate slightly to create a clearance.
3. Fold seat forward and back ensuring tension bar is clear of the side plate.
4. Refit seat cushion.
5. Repeat for opposite seat if necessary.

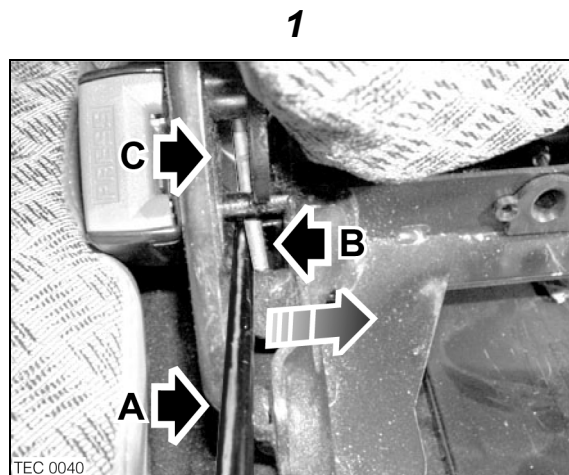

PARTS INFORMATION:

Not applicable

WARRANTY CLAIMS:

Use Complaint Code: 8A3K

Use S.R.O.: 78.90.89/27

Time allowance: 0.10 Hrs