TECHNICAL BULLETIN



MODEL/DERIVATIVE:

Freelander

Bulletin Nº: **0009** CDS. ref: **L8725bu**

Issue: 2

Date: 16.01.02

AFFECTED RANGE:

All derivatives up to VIN 1A 576765

RE - ISSUE INFORMATION:

PROBLEM and ACTION: - Text amended.

Please destroy your existing copy and replace with this Issue 2.

PROBLEM:

NOISE FROM THE REAR OF THE VEHICLE - REAR DIFFERENTIAL

An increase in bearing or gear noise may be experienced from the rear differential.

NOTE: This should not be confused with rear tyre noise that is described in Technical Bulletin 0008.

CAUSE:

Left hand differential carrier bearing worn.

ACTION:

Where a complaint of the above is confirmed, replace the rear differential with a new differential now available from Land Rover Parts. The new differential has been designed to incorporate larger differential carrier bearings.

NOTE: The new specification differential is compatible with all Intermediate Reduction Drive (IRD) unit designs and ratios.

Replace the rear differential assembly, refer to Workshop Manual, Rear Axle And Final Drive, Differential Assembly, repair number 51.15.01.

PARTS INFORMATION:

TVK000180 - Differential assembly - rear

TECHNICAL BULLETIN No: 0009 ISSUE: 2

PAGE: 1 OF 2

WARRANTY CLAIMS:

Use Complaint Code: 4Q1K

Use S.R.O.: 51.15.01

Time allowance: 0.90 Hrs

Please return discarded parts to Land Rover.

TECHNICAL BULLETIN Nº: 0009 ISSUE: 2

PAGE: 1 OF 2