

# TECHNICAL BULLETIN



**MODEL/DERIVATIVE:**  
Defender

**Bulletin N°:** 0093  
**CDS. ref:** L8738bu  
**Issue:** 1  
**Date:** 06.02.02

**AFFECTED RANGE:**  
All derivatives except High Capacity Pick up


**PROBLEM:**  
**CORROSION AROUND THE REAR BODY CORNER CAPPING**  
Corrosion may be evident around the left or right hand rear body corner capping, see inset in illustration 1.

**CAUSE:**  
Due to material specification and design of the connecting panel work.

**ACTION:**  
Where a complaint of the above is confirmed, follow the rectification procedure below to replace the rear body corner capping.

### Rectification procedure

1. Remove the rear direction indicator, tail lamp, reflector and the reverse or fog lamp.
2. **RIGHT HAND:** remove the Land Rover logo and decals.
3. **LEFT HAND:** remove the rear number plate lamp, refer to Workshop Manual, part number LRL0097 (3<sup>rd</sup> edition), Electrical, Rear Number Plate Lamp, repair number 86.40.86. Remove the number plate.
4. Drill out rivets securing the corner capping.
5. Carefully remove the corner capping.
6. Remove any corrosion from the body panels.
7. Etch prime any bare metal.
8. Apply primer to the prepared area and the mating faces of the new corner capping.
9. Carefully position the new corner capping and secure with rivets.
10. Local paint the corner capping and the body panels.
11. Fade out into existing body colour.
12. Fit removed components.

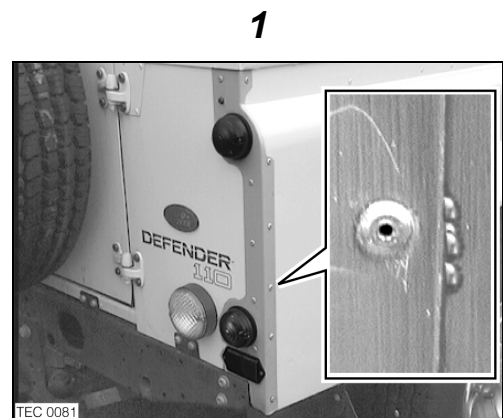

Right hand shown for illustration purposes only

*PARTS INFORMATION:*

**AQL710021 - Capping - right hand**

**AQL710031 - Capping - left hand**

**78248 - rivet**

---

*WARRANTY CLAIMS:*

**Use Complaint Code: 9A4H**

**Use S.R.O.: 76.10.89/77 - Body rear corner capping - right hand side - renew**

**Time allowance: 2.40 Hrs**

**Use S.R.O.: 76.10.89/78 - Body rear corner capping - left hand side - renew**

**Time allowance: 2.30 Hrs**

**Use S.R.O.: 76.10.89/79 - Body rear corner capping - both sides - renew**

**Time allowance: 3.00 Hrs**