

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Defender

Bulletin N°: **0092**
CDS. ref: **L8751bu**
Issue: **1**
Date: **30.01.02**

AFFECTED RANGE:

All derivatives except vehicles fitted with half doors in VIN range 2A 622429 to 2A 627483

PROBLEM:

DIFFICULT TO RELEASE KEY FROM DOOR LOCKING BARREL

When fitting a new door locking barrel the key may not release from the barrel.


CAUSE:

The stiffening ring in the locking sleeve could prevent the first lock tumbler from lifting when the key is withdrawn, preventing removal of the key.

ACTION:

Before fitting a new door locking barrel to vehicles in VIN range 2A 622429 to 2A 627483, the door lock barrel must be modified by following the procedure below.

1. Remove the first tumbler and spring (Arrowed in illustration 1), from the door locking barrel.

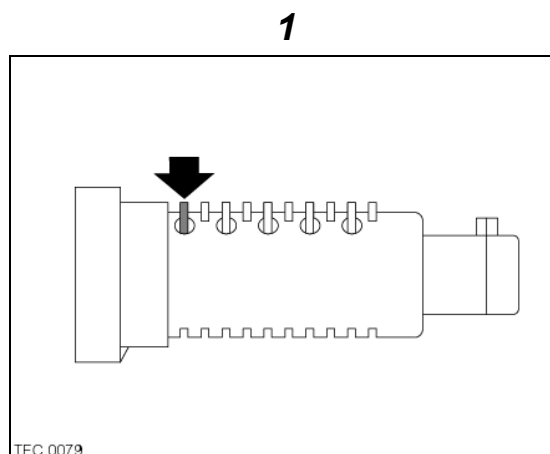

PARTS INFORMATION:

Not applicable

WARRANTY CLAIMS:

Not applicable