


CIRCULATE TO:-	
SERVICE MGR.	X
RECEPTION	X
WORKSHOP	X
PARTS	X

TestBook Information



MODEL New Range Rover		SUBJECT BeCM Market Programming	31/07/96 TB009/96/EN
		AFFECTED VEHICLES LP 346794 Onwards LH LJ LD	

DETAIL
 When using Testbook DRF 0007 Disc for after market re-programming on vehicles from the above Vin number fitted with low line BeCMs, the vehicle electrical lighting system combined with the BeCM will exhibit the following condition:

1. Flash Headlamps continuously.
2. Flash rear fog lamps continuously.
3. It will not be possible to stop the lights flashing until the BeCM goes to sleep.

This condition will also be experienced should a replacement BeCM part number AMR 6000 be fitted and configured to the required market programme.

Do not attempt to reconfigure market programming on affected vehicles, without using Engineering gold Disc or DRG 0001 disc.

Note: The high line BeCM is not affected by this condition.


ACTION REQUIRED
 Should this condition be experienced there will be a small number of Engineering Gold Disc's available from the TestBook Help Desk: Telephone number *(44) 01865 74 6699 which will be despatched on request. The full DRG 0001 Disc will overcome the above concerns, and will be distributed direct in the normal manner.

PARTS INFORMATION

AMR 6000 Low line BeCM.

DRF 0008Y Engineering Disc (gold).

DRG 0001 Complete diagnostic disc.

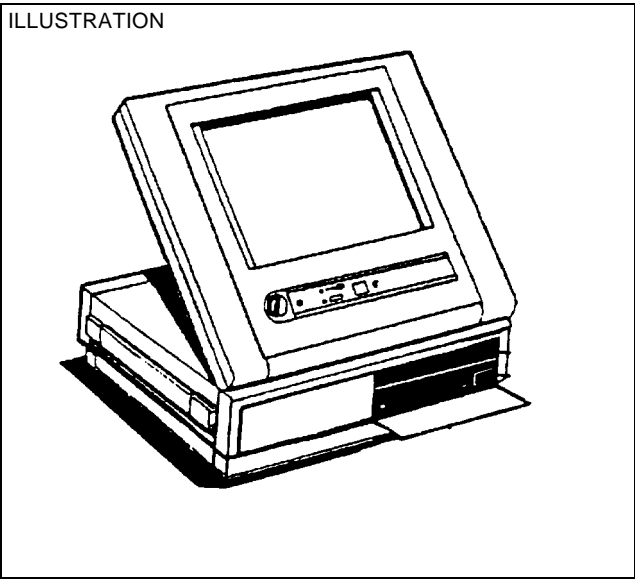

PROCEDURE

1. Insert Engineering Disc DRF 0008Y into TestBook.
2. Diagnostic System.
3. Follow screen reference for market Programming

WARRANTY
 Normal warranty policy and procedures apply

COMP. CODE
6U4U

SRO
 86.90.57/01 Market programming process
 0.50 hour