

CIRCULATE TO:-	
SERVICE MGR.	X
RECEPTION	X
WORKSHOP	X
PARTS	X

TestBook Information



SUBJECT		02/10/96
Vehicle Configuration		TB012/96/EN
MODEL	AFFECTED VEHICLES	
New Range Rover Diesel Derivatives	LP 316176 Onwards	
	LH	
	LJ	
	LD	

DETAIL


When using TestBook CD Disc DRG 0001 for BeCM configuration or Market Programming on Range Rover Diesels from the above Vin number, the vehicles security system will **immobilise the engine**. This condition will be corrected with the issue of DRG 0002 Disc.

Note: Do not use Disc DRF 0001 for vehicle configuration.

ACTION REQUIRED
Should a vehicle have become immobilised after using disc DRG 0001, there will be a small number of Engineering Gold disc's available from the TestBook Help Desk: (44) 0186574 6699 which will be despatched on request.

PARTS INFORMATION

Gold Engineering CD Disc can be obtained prior to DRG 0002 becoming available.

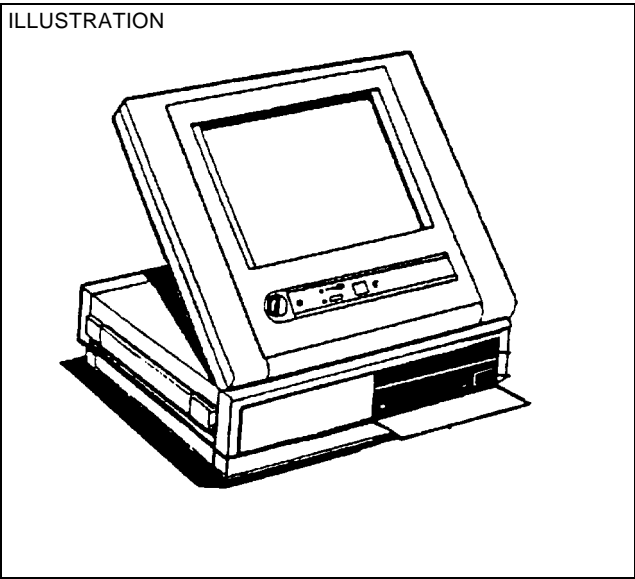

PROCEDURE
Procedure for BeCM configuration or Market Programming on Range Rover Diesel prior to DRG0002 release.

To program a Diesel vehicle at P.D.I, or when replacing a BeCM, use TestBook disc DRF 0007 to programme the vehicle. Should the vehicle headlamps and rear fog lamps flash after programming the BeCM, replace the disc with disc DRG 0001 and select the appropriate market in Market Selection.

Should the vehicle features require changing ie : LANGUAGE, SUNROOF, TRIP COMPUTER and FRONT FOG LIGHTS, use CD Disc DRF 0007 to complete this operation.

Note: Do not use Disc DRF 0001 for vehicle configuration.

WARRANTY
Normal warranty policy and procedures apply

COMP. CODE
Not applicable

SRO
Refer to bulletin TB006/96 for individual times