

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Discovery Series II

Bulletin N°: 0062
CDS. ref: L8620bu
Issue: 1
Date: 24.01.01

AFFECTED RANGE:

All vehicles with occasional rear seats in VIN ranges: XA 900012 to XA 907212
XA 200412 to YA 290241

PROBLEM:

SCUFF MARKS ON OCCASIONAL REAR SEAT SQUAB (THIRD ROW)

The customer complains of damage to the squab cover adjacent to the seat belt buckle.


CAUSE:

Seat belt buckle remaining in raised position when seat is stowed.

ACTION:

Replace the inner squab hinge cover on both seats with modified covers incorporating a spring which automatically lowers the seat belt buckle. The new parts are now available in vehicle sets, refer to *PARTS INFORMATION*.

1. Pull off the squab release lever.
2. Remove the seat belt anchorage Torx bolt and remove buckle.
3. Remove the screw securing the hinge cover and remove cover.
4. Replace hinge cover with new cover from kit and secure with screw.
5. Obtain the appropriate return spring from the kit, (left hand illustrated) and engage with the seat belt buckle as shown at 'A'.

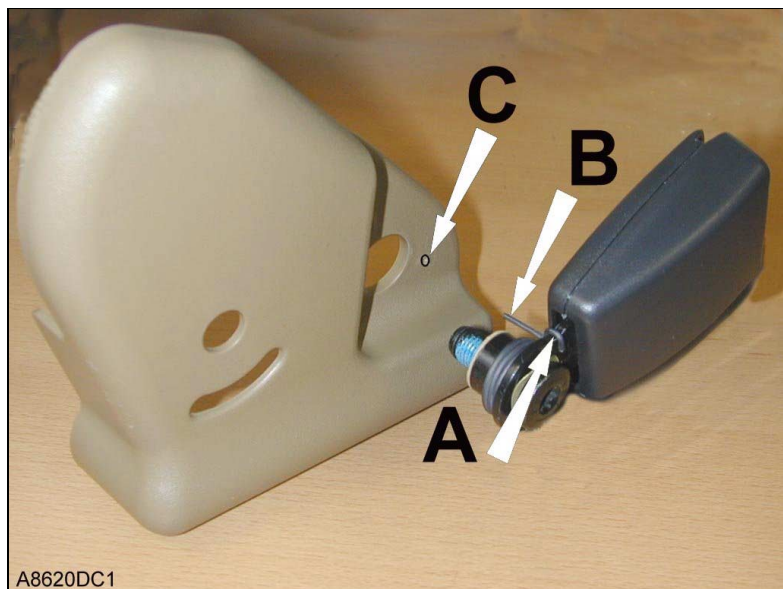

6. Refit seat belt buckle, locating the free end of the spring 'B', into hole 'C' in the hinge cover.
7. Apply lubricant such as STC4224 (Tefoil with PTFE spray) to the seat belt buckle pivot and anti-rattle washer.

8. Tighten the seat belt buckle Torx bolt to 32Nm.
 9. Confirm that the seat belt buckle returns freely to the lower position when released.
 10. Refit squab release lever.
 11. Repeat for other seat.
-

PARTS INFORMATION:

VUB000250LPW Kit - seat belt fixing - Dark Smokestone

VUB000250SUC Kit - seat belt fixing - Bahama Beige

WARRANTY CLAIMS:

Use Complaint Code: 8Y4F

Use S.R.O.: 78.85.44 Hinge cover - inner- right hand - renew

Time allowance: 0.10Hrs

Use S.R.O.: 78.85.45 Hinge cover - inner- left hand - renew

Time allowance: 0.10Hrs