TECHNICAL BULLETIN



MODEL/DERIVATIVE:

Freelander

Bulletin Nº: **0037** CDS. ref: **L8653bu**

Issue:

Date: 01.08.01

AFFECTED RANGE:

All vehicles in VIN range: YA 574912 to 1A 588509

PROBLEM:

POOR FRONT SCREEN WIPER PERFORMANCE

One or both of the wiper blades may not clear the screen to a satisfactory level and may also judder in operation.

CAUSE:

Wiper arm incorrectly formed causing the wiper blade to operate at an incorrect angle.

ACTION:

Where a customer complaint of poor wiper performance and / or judder is confirmed and the vehicle is in the above VIN range, replace both wiper arms and blades.

Refer to PARTS INFORMATION for correct derivative application.

Refer to Workshop Manual repair number 84.15.02 for repair procedure.

PARTS INFORMATION:

Description		Part Number
RHD	Wiper arm - Driver	DKB103020
	Wiper arm - Passenger	DKB103080
	Wiper blade - Driver	AWR4679
	Wiper blade - Passenger	AWR4113
LHD	Wiper arm - Driver	DKB103090
	Wiper arm - Passenger	DKB103030
	Wiper blade - Driver	AWR4680
	Wiper blade - Passenger	AWR4112

TECHNICAL BULLETIN Nº: 0037 ISSUE: 1 PAGE: 1 OF 2

WARRANTY CLAIMS:

Use Complaint Code: 7R6L

Use S.R.O.: 84.15.01 Renew both wiper arms and blades.

Time allowance: 0.10Hrs

Normal Warranty Policy and Procedures apply.

TECHNICAL BULLETIN Nº: 0037 ISSUE: 1

PAGE: 2 OF 2