

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Freelander


Bulletin N°: 0073
CDS. ref: L8681bu
Issue: 1
Date: 04.07.01

AFFECTED RANGE:
All derivatives in VIN range 1A 315400 to 1A 336686

PROBLEM:
SEAL - PLENUM COVER TO WINDSCREEN - ADRIFT FROM PLENUM COVER
The customer complains of the untidy appearance of the plenum cover to windscreen seal.

CAUSE:
Poor adhesion of the seal to the plenum cover.

ACTION:
On customer complaint of the above, secure the section of the seal which is displaced to the plenum cover, using the cleaning and adhesive materials detailed in *PARTS INFORMATION*.
Apply the adhesive sparingly to ensure that no excess is squeezed out when the seal is refitted.

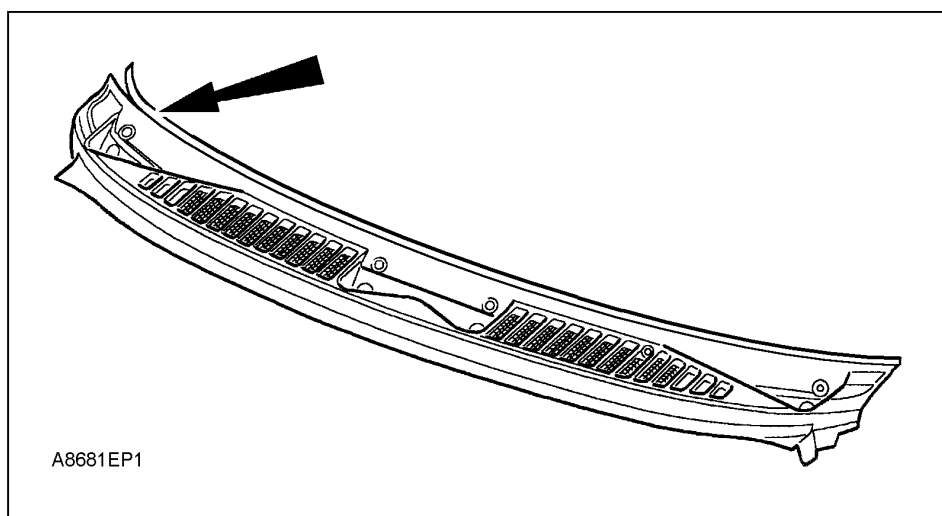

PARTS INFORMATION:
CKU000020K - Adhesive Kit - containing adhesive, mixer unit and spirit wipe
NOTE: The adhesive is applied using the reusable applicator gun supplied in Adhesive Kit CKU000010K.
Dealers should already be in possession of this item following its use in Service Action A/D388 - Freelander Taildoor Glass.
It should therefore not be necessary to reorder CKU000010K.

WARRANTY CLAIMS:

Use Complaint Code: 9M4B

Use S.R.O.: 80.15.89/51

Time allowance: 0.10Hrs