

# TECHNICAL BULLETIN



*MODEL/DERIVATIVE:*  
**Discovery Series II**

*Bulletin N°:* **0039**  
*CDS. ref:* **L8698bu**  
*Issue:* **1**  
*Date:* **29.08.01**

*AFFECTED RANGE:*  
**All vehicles up to VIN 1A 702554**

*PROBLEM:*  
**CENTRALLY HIGH MOUNTED STOP LAMP (CHMSL) LOOSE**  
The customer complains that the CHMSL has become loose and/or come away from the screen.

*CAUSE:*  
The CHMSL becomes loose due to lack of torque control applied to plastic fixing nuts during production.

*ACTION:*  
If a customer complaint of the above has been confirmed replace the existing plastic nuts with the new metal nuts part number - 53K2826L.  
Refer to Workshop Manual, Electrical, repair number 86.41.32 for repair procedure.  
**Note:** Tighten nuts to a torque of 1.5 Nm.

*PARTS INFORMATION:*  
**53K2826L - metal fixing nut**

*WARRANTY CLAIMS:*  
**Use Complaint Code: 7J0G**  
**Use S.R.O.: 86.41.32**  
**Time allowance: 0.10 Hrs**