



CIRCULATE TO:-		[REDACTED]		
SERVICE MGR.	X			
RECEPTION	X			
WORKSHOP	X			
PARTS	X	SUBJECT		30/10/96
		Front Axle Driveshaft - Oil Leak		NRR/54/03/96/EN
MODEL		AFFECTED VEHICLES		
New Range Rover		LP	348603 Onwards	
		LH		
		LJ		
		LD		

DETAIL

In the event of an oil leak becoming evident from the front driveshaft seal around the yolk area, a new driveshaft seal has been introduced.

ACTION REQUIRED


Upon customer complaint of an oil leak around the driveshaft area, the new revised seal should be fitted, together with the brake caliper bolts and hub assembly bolts as detailed in the parts section.

PARTS INFORMATION

FTC 4822 replaces FTC 3452 driveshaft seal

Also required

FTC 2996 brake caliper bolts (4 off)
 FC 112127P hub assembly bolts (8 off)

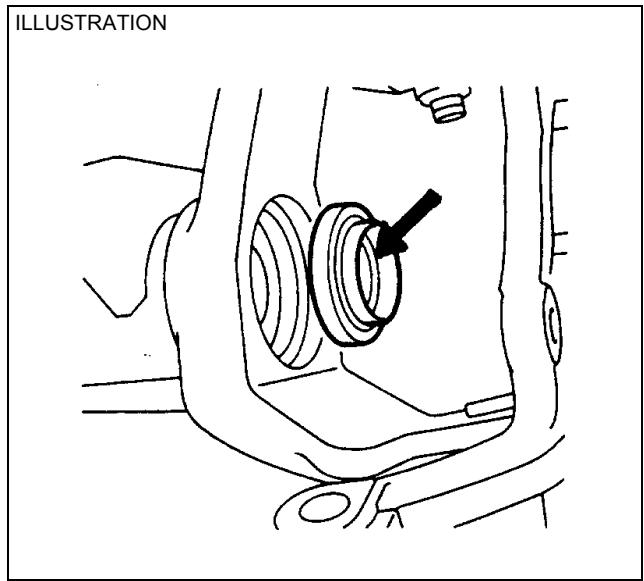

PROCEDURE

Refer to the workshop manual section 54

Note: New service tool No LRT-54-012 should be used in conjunction with the driveshaft seal.

WARRANTY

Normal warranty policy and procedures apply

COMP. CODE
4S2N

SRO

54.15.04 oil seal each renew 00.90 hour