

AVO[®]
AVO INTERNATIONAL

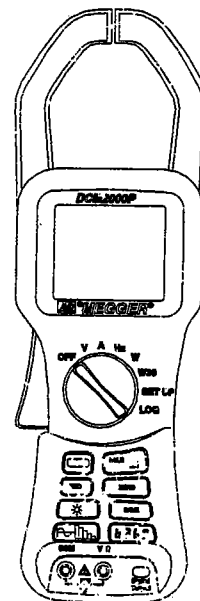
UNITED KINGDOM
ARCHCLIFFE ROAD, DOVER, KENT CT17 9EN
ENGLAND
TEL: +44 (0)1304-502100
FAX: +44 (0)1304-502300/207342
EMAIL: avosales.dover@avointl.com

UNITED STATES
4651 S.WESTMORELAND ROAD
DALLAS, TX 75327 - 1017 USA
TEL: +1 (800) 723-2861 (USA ONLY)
TEL: +1 (214) 330-3203 (INTERNATIONAL)
FAX: (214) 333-3533
EXPORT FAX: (214) 337-3308

UNITED STATES
4651 S.WESTMORELAND ROAD
DALLAS, TX 75327 - 1017 USA
TEL: +1 (214) 330-3203
FAX: (214) 333-3533
EXPORT FAX: (214) 337-3038

MEGGER S.A.
29 ALLÉE DE VILLECOMBLE
93340 LE RAINCY
PARIS, FRANCE
TEL: +33 (1) 43.02.37.54
FAX: +33 (1) 43.02.16.24

MEGGER[®] **DCM2000P**



Power Clampmeter
Pince wattmétrique
Zangen-Leistungsmesser

User guide
Guide Utilisateur
Gebrauchsanleitung

This instrument is manufactured in the United Kingdom. The company reserves the right to change the specification or design without prior notice. **MEGGER** is a registered trademark of AVO INTERNATIONAL LIMITED
©AVO INTERNATIONAL LIMITED
Part number 6172-436 - Edition 1 - Printed in England 3DD

MEGGER[®]

SAFETY WARNINGS

International Electrical Symbols



Caution! Refer to this manual before using the meter



Meter is protected by Reinforced or Double Insulation

Important Information

- The instrument is intended for indoor use only.
- Do not attempt to take any measurement of current or voltage higher than the maximum range of the instrument.
- The unit is not hermetically sealed and should NOT be brought into contact with surface water.
- Frequently inspect the test leads and the instrument for damage. If the instrument is physically damaged or does not function properly, it should not be used.
- Repair and servicing must only be conducted by AVO International Ltd or designated agents.

USE ONLY SUITABLY RATED VOLTAGE TEST LEADS TO IEC 61010-2-031. (600V CAT IV Pollution Degree 2).

SAFETY WARNING

Before removing the battery cover, make sure that all external voltages are disconnected from the instrument. For certainty remove all leads and unclamp the instrument.

CONTENTS

PAGE

1 SAFETY	2
2 INTRODUCTION	3
2.1 Instrument Features	4
3 OPERATING INSTRUCTIONS	5
3.1 Rotary Switch / Keypad Selections	5
3.2 Voltage Measurement	6
3.3 Current Measurement	8
3.4 Watts / VA / PF / kWhr Measurements	9
3.5 W3Ø / VA / PF / kWhr Measurements	10
3.6 Frequency / THD Measurement	11
3.7 Set Up	12
3.8 Log	12
4 BATTERY REPLACEMENT	15
5 SPECIFICATION	16
5.1 Electrical Data	16
5.2 General Data	21
6 ACCESSORIES	22
7 WARRANTY	23



1. SAFETY

The instrument has been designed to comply with IEC 61010-2-032 Installation Category (Overvoltage Category) IV 600V Pollution degree 2 and UL 3111-1. The DCM2000P conforms with the EEC Low Voltage Directive 73/23/EEC and 93/68/EEC.

IEC 61010-1 is a safety standard which has the following features:

- Installation categories I to IV relate the maximum working voltage to overvoltage transients that can be expected in the measuring environment. For the DCM2000P instrument, 600V CAT IV, the maximum expected transients must not exceed 8kV peak.
- In a pollution degree 2 environment the internal design of the instrument can cope with transient conductivities due to condensation.

Safe operation of the instrument is the responsibility of the operator who must be suitably qualified and/or authorised. Users of this equipment and or their employees are reminded that Health and Safety Legislation requires them to carry out valid risk assessments of all electrical work, so as to identify potential sources of electrical danger and risk of electrical injury such as from inadvertent short circuits. Where the assessments show that the risk is significant, then the use of fused test leads constructed in accordance with the HSE guidance note GS38 'Electrical Test Equipment for use by Electricians' is advised.

If the instrument is used in a manner not specified by the manufacturer, then the protection provided by the equipment may be impaired.

Maximum Safe Voltage

Current :- 600V MAXIMUM AC RMS or DC between uninsulated conductor and ground and maximum frequency of 1kHz. This limitation applies to uninsulated conductors only.

Voltage:- 600V MAXIMUM AC RMS or DC between live conductor and ground. 600V MAXIMUM AC RMS or DC between V and COM terminals and a maximum frequency of 1kHz.

2. INTRODUCTION

The advanced design of the DCM2000P ensures reliable and accurate measurements under a wide range of operating conditions. Measurement features include:

- Non-intrusive AC/DC current
- True RMS, Crest Factor and THD for complex and distorted waveforms
- Volts / Watts / VA / PF / kWhr
- 3 Phase measurements
- Screen SAVE mode
- MIN, MAX, AVE, REC Mode
- Internal and PC Data logging*
- Multi parameter and waveform display modes
- Live harmonics analysis and display
- Ripple measurement
- Extended memory for data logging

The DCM2000P conforms to the latest international directives and standards concerning safety and electromagnetic compatibility.

- European Low Voltage Directive 73/23/EEC and 93/68/EEC
- European EMC Directive 89/336/EEC and 93/68/EEC

Safety Standards

IEC 61010-1: 1992-09 Safety requirements for electrical equipment for measurement, control and laboratory use.

Part 2-032: 1994-12 Particular requirements for hand held current clamps for electrical measurement and test.

Part 2-031: 1993-02 Particular requirements for hand held probe assemblies for electrical measurement and test.

600V Cat IV (750V cat III) Pollution degree 2

EMC Standards

RF Susceptibility

EN 50082-1: 1992 3V/m Residential, Commercial and Light Industry

RF Emission

EN 50081-1: 1992 Residential, Commercial and Light Industry

FCC Part 15 Class B

*Requires optional PowerLog accessory

2.1 Instrument Features

The main operating features of the instrument are as follows. See Fig. 1.

- (1) Clamp-on jaws for current measurement
- (2) Jaw opening lever
- (3) Rotary switch for function selection
- (4) Dot matrix LCD
- (5) Screen cursor control
- (6) REC mode
- (7) Backlight
- (8) Oscilloscope / Harmonics mode
- (9) HOLD and SELECT
- (10) ZERO. Amps Zero
- (11) SAVE. Screen save mode
- (12) Numeric display mode
- (13) and (14) Test lead input terminals
- (15) Digital output

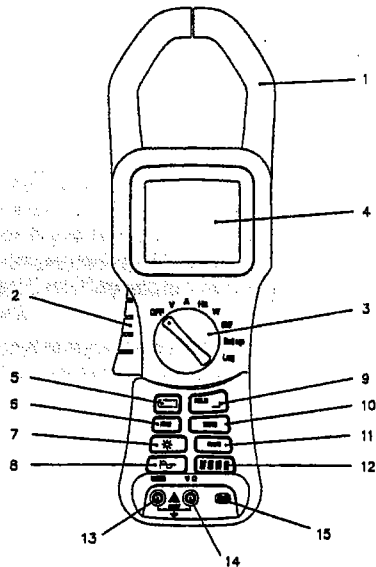


Fig. 1
Instrument Features

3. OPERATING INSTRUCTIONS


3.1 Rotary Switch / Keypad selections

The instrument functions are selected by a rotary switch and an 8 key keypad. The rotary switch positions are as follows:

OFF	Instrument off
V	Voltage
A	Current
Hz	Frequency / THD
W	Power
W3Ø	3 phase Power
Set up	Options Menu
Log	Logging Menu

When switching the instrument ON, wait for the auto calibration to finish before taking measurements.

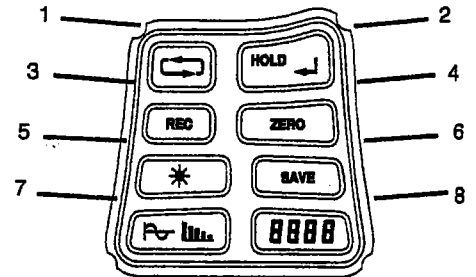The push button keys are as follows:





1. Option cursor movement and screen changer
2. HOLD and Option select
3. REC mode (Min, Max, Ave)
4. ZERO
5. Backlight ON / OFF
6. SAVE
7. Oscilloscope/Harmonics mode
8. Numeric Display mode

SAVE Mode

This function allows the capture of up to 8 screens which can be either waveforms or numerical data. Both waveform and harmonics screens are captured simultaneously in one memory location. Pressing the SAVE mode key brings up the following text on the screen:

```
SAVE RECOVER CLEAR
1 2 3 4 5 6 7 8
```






Use the  key to move the cursor and the  key to select either SAVE, RECOVER or CLEAR. Repeat this process to select one of the SAVE locations from 1 to 8.


The whole screen is saved in the selected location and can be recovered at a later date - even after the instrument has been powered off. A second press of the SAVE key returns the instrument back to the normal mode of operation.

3.2 Voltage measurement

SAFETY WARNING

To avoid possible electric shock and damage to the instrument, do not attempt to measure any voltage that might exceed the maximum range of the instrument - 600Vrms and 1kHz

- Move the rotary switch to the V position.
- Insert the test leads into the sockets on the front of the instrument. Connect the red lead to the V terminal, and the black lead to the COM terminal.
- Apply the test leads to the circuit under test and read the displayed voltage. See Fig. 2.
- Use the  key to change the parameters displayed.
 - Screen 1 = V DC, V RMS (AC + DC)
 - Screen 2 = V RMS, V Av, V Pk, V CF, V Hz
 - Screen 2 = V RMS, V Av, V Pk, V CF, V RPL
- Use the HOLD key to freeze the display.
- Use the  key to display the waveform of the voltage and the  key to change the timebase.
- Use the  key to display the harmonic content of the voltage and the  key to select individual harmonics.
- Use the 8888 key to return to the digital display.
- Use the REC key to enter the RECORD mode. Use

the  key to show the MAX, MIN, AVE displays of the screen readings. Press the REC key again to exit.

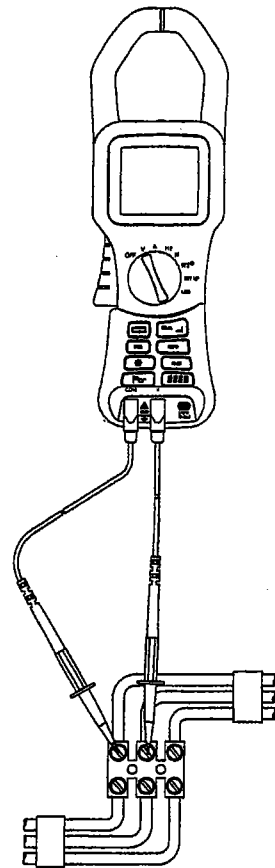








Fig. 2
Voltage Measurement

3.3 Current measurement

- Remove any Voltage test leads from the instrument.
- Move the rotary switch to A position.
- Press the trigger to open the jaws and clamp around the current carrying conductor as shown in Fig. 3.
- Read the display. Use the  key to change the parameters displayed.
Screen 1 = A DC, A RMS (AC + DC)
Screen 2 = A RMS, A Av, A Pk, A CF, A Rpl
- Use the HOLD key to freeze the display.
- Use the  key to display the waveform of the current and the  key to change the timebase.
- Use the  key to display the harmonic content of the current and the  key to select individual harmonics
- Use the 8888 key to return to the digital display.
- Use the ZERO key to zero the display if necessary or if relative readings are required.
- Use the REC key to enter the RECORD mode.
Use the  key to show the MAX, MIN, AVE values of the screen readings. Press the REC key to exit.

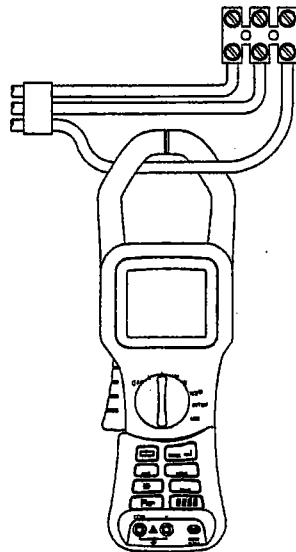




Fig. 3
Current Measurement

3.4 Watts / VA / PF / kWhr Measurements

- Move the rotary switch to the W position.
- Insert the test leads into the sockets on the front of the instrument. Connect the red lead to the V terminal, and the black lead to the COM terminal.
- Press the trigger to open the jaws, and clamp them on the current carrying conductor, as shown in Fig. 4.
- Read the display. Use the  key to change the parameters displayed.
Screen 1 = kVA, kW, kVAR, PF, kWhr
Screen 2 = V RMS, A RMS, kW, PF, Ahr
- Use the HOLD key to freeze the display.
- Use the REC key to enter RECORD mode. Use the  key to show the MAX, MIN, AVE displays of the screen readings. Press the REC key again to exit.

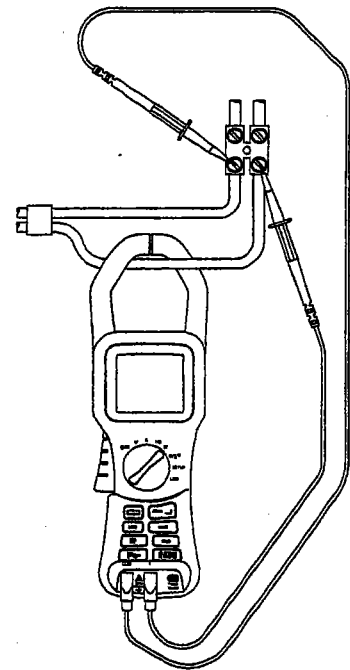


Fig. 4
Single Phase Watts Measurement

3.5 W3 \emptyset / VA / PF / kWhr Measurements

- Move the rotary switch to the W3 \emptyset position.
- A screen prompt, Fig. 5, indicates the above method of connection.
- Insert the test leads into the sockets on the front of the instrument. Connect the red lead to the V terminal and the black lead to the COM terminal.
- Apply the test leads to the circuit under test:
Red lead to Phase L2
Black lead to Phase L3
- Press the trigger to open the jaws and clamp them around the current carrying Phase L1, as shown in Fig. 5.
- Read the display. Use the \leftarrow key to change the parameters displayed.
Screen1 = kVA, kW, kVAR, PF, kWhr
Screen2 = V RMS, A RMS, kW, PF, Ahr
- Use the HOLD key to freeze the display.
- Use the REC key to enter RECORD mode. Use the \leftarrow key to show the MAX, MIN, AVE displays of the screen readings. Press the REC key again to exit this mode.

W3 \emptyset gives the total power based on a balanced system.

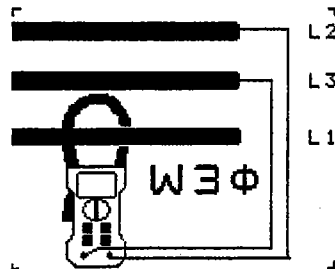


Fig. 5
Watts 3 \emptyset Configuration


3.6 Frequency / THD Measurement

- Move the rotary switch to the Hz position.
- Insert the test leads into the sockets on the front of the instrument. Connect the red lead to the V terminal, and the black lead to the COM terminal.
- To measure the frequency of the voltage supply apply the test leads to the circuit as shown in Fig. 2 and read the display.
- To measure the frequency of the current, press the trigger to open the jaws, and clamp them on the current carrying conductor, as shown in Fig. 3 and read the display.
- Use the \leftarrow key to change the parameters displayed.
Screen 1 = Hz, ACRMS
Screen 2 = Hz(F₀), ACRMS, THD, DF
- When configured to measure power (Fig. 4) with the test leads connected and the jaws clamped around a current carrying conductor, the instrument displays the frequency of the current source (providing ARMS > 10A). If ARMS < 10A, a volts frequency measurement will be made (providing VRMS > 1V), otherwise --- will be displayed.
- Press the HOLD / ZERO button to freeze the display.
- Use the REC key to enter RECORD mode. Use the \leftarrow key to show the MAX, MIN, AVE displays of the screen readings. Press the REC key again to exit this mode.
- Use the \leftarrow key to display the waveform of the current / voltage and the \leftarrow key to change the timebase.
- Use the \leftarrow key to display the harmonic content of the current/voltage and the \leftarrow key to select individual harmonics.

3.7 Set Up

The following screen is displayed:

CONTRAST	XXXXXXX
AUTO POWER DOWN	ON or OFF
RANGING	ON or OFF
LOW PASS FILTER	ON or OFF
PF DISPLAY	DEG or COSØ

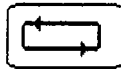

SELECT



CHANGE

LOW PASS FILTER (ON) = -12dB / octave, F>100Hz

Default settings are shown in bold.


The keys are used to make selections from the menu.

3.8 LOG

Two modes of data logging are available: either logging to an internal non-volatile memory or logging to an external PC, using the digital output lead.

Selection of the rotary switch position 'LOG' brings up the following menu:

	OPTIONS
LOG	.INT <PC>
SET TIME	
ENABLE LOG	OFF <ON>
DISPLAY DATA	
SEND TO PC	

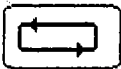

SELECT



CHANGE


Detailed description is as given below:

INT Indicates internal logging
PC Indicates external (to a PC) logging

In PC mode, data is continually sent to the digital output and is not logged within the instrument. The instrument logs all the parameters shown on the instrument display.

SET TIME

 Increments the selection

HOLD  Moves on to the next selection

For ease of operation if the current time is changed, then the start is automatically reset to this time + 60 minutes, and the end time is set to the start time + 60 minutes. The minimum sample interval is 1 second, and the maximum sample 1 hour. A 24 hour clock is used.

Start / Stop and logging intervals can be selected as required.

CURRENT	TIME	HR:MIN
START	TIME	HR:MIN
END	TIME	HR:MIN
SAMPLE INTERVAL		MIN:SEC
EXIT		


The maximum number of points that can be logged is: **5000 readings** (2500 sets of 2 or 1000 sets of 5)

The maximum logging duration is determined by the battery life (24hrs.) and the memory. Data being logged is an average over the sample period.

ENABLE LOG



The logging function can be enabled from the main log menu. The low battery symbol flashes if there is insufficient battery life to complete the logging session defined in the SET TIME menu.

When internal logging is enabled the logging will commence within 5 seconds of selecting the

measurement screen with the rotary switch and key. All data displayed on the selected screen will be logged. 'MEMORY' flashes if there is insufficient memory to complete the logging session defined in the SET TIME menu. Once logging has commenced an on screen timer counts down the remaining logging period. Logging will terminate if the screen display is changed through moving the rotary switch or pressing the  key before the end of the logging session.

If PC logging is enabled, all measurements appearing on the instruments display will be logged to the PC. Logging will not terminate if the screen is changed.


DISPLAY DATA

On entry to this menu a list of the parameters which have been logged are displayed. The  key increments through the list, and the **HOLD**  key selects ONE parameter for display. For example:

ARMS, A Av, A Pk, A CF

EXIT returns to the previous menu.

On the chart display screen the single parameter is shown vs time, and an **EXIT** is displayed on the screen allowing the user to return to the logging parameter select menu.

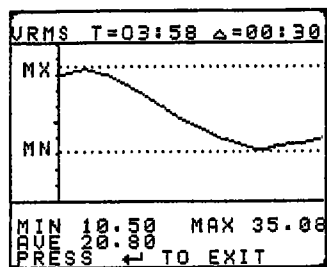

The following information is also displayed:

LOGGING DURATION T = HR:MIN
SAMPLE INTERVAL Δ = MIN:SEC
MIN MAX AVE

SEND TO PC


This allows the user to download data to a PC running the PowerLog program. Previously the user must have selected "DOWNLOAD LOG" from the Instrument option within the PowerLog program.

On selection of **SEND TO PC** the text will flash until all data has been downloaded to the PC.

4. BATTERY REPLACEMENT

Replacement with other than the specified batteries will invalidate the warranty.

Fit only Battery Type 1.5V Alkaline MN1500, IEC LR6 or equivalent x 6.

 will appear on the LCD display to indicate that the minimum operating battery voltage has been reached.

To change the batteries, see Fig. 6

- Switch off the instrument
- Undo the retaining screws (A and B) on the battery cover and lift the cover clear of the unit.
- Replace the used batteries
- Ensure the battery cover is replaced and the locking screws tightened, before further use.

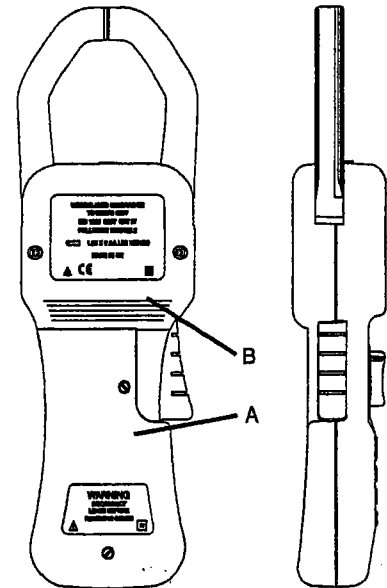


Fig. 6
Battery Replacement

5. SPECIFICATION

5.1 Electrical data

(All accuracies stated at $23^{\circ}\text{C} \pm 1^{\circ}\text{C}$)

5.1.1 Current measurement

(DC, DCRMS, ACRMS)

Measuring range 0 - 2000A DC or AC pk

Autorange facility 40A / 400A / 2000A

Resolution 10mA in 40A range
100mA in 400A range
1A in 2000A range

Accuracy

RMS and DC

I > 10A $\pm 1.5\%$ rdg ± 5 dgts

I < 10A $\pm 0.2\text{A}$

AVE

I > 10A $\pm 3\%$ rdg ± 5 dgts

I < 10A $\pm 0.5\text{A}$

Pk

I > 10A $\pm 5\%$ rdg ± 5 dgts

I < 10A $\pm 0.5\text{A}$

AHr

I > 10AHr $\pm 2\%$ rdg ± 5 dgts

I < 10AHr $\pm 0.5\text{AHr}$

CF (Crest Factor)

$1 \leq \text{CF} < 3$ $\pm 3\%$ rdg ± 5 dgts

$3 \leq \text{CF} < 5$ $\pm 5\%$ rdg ± 5 dgts

Resolution 0.01

RPL (Ripple)

$2\% \leq \text{RPL} < 100\%$ $\pm 3\%$ rdg ± 5 dgts

$100\% \leq \text{RPL} < 600\%$ $\pm 5\%$ rdg ± 5 dgts

Resolution 0.1%

$I_{\text{DC}} > 5\text{A}$, $I_{\text{AC}} > 2\text{A}$

All measurements DC and 10Hz to 1kHz. Maximum overload 10,000A or RMS x frequency < 400,000. Amps RMS is a true RMS measurement (AC + DC)

Harmonics

THD (Total Harmonic Distortion)

$1\% \leq \text{THD} < 100\%$ $\pm 3\%$ rdg ± 5 dgts

$100\% \leq \text{THD} < 600\%$ $\pm 5\%$ rdg ± 5 dgts

Resolution 0.1%

DF (Distortion Factor)

$1\% \leq \text{DF} < 100\%$ $\pm 3\%$ rdg ± 5 dgts

Resolution 0.1%

$\text{H01} \leq I_{\text{harm}} < \text{H13}$ $\pm 5\%$ rdg ± 2 dgts

$\text{H13} \leq I_{\text{harm}} \leq \text{H25}$ $\pm 10\%$ rdg ± 2 dgts

All measurements up to 25th harmonic.

Frequency range F_0 45Hz to 65Hz

$I_{\text{ac rms}} > 10\text{A}$, $I_{\text{harm}} > 10\%$ $I_{\text{ac rms}}$

5.1.2 Voltage measurement

(DC, DCRMS, ACRMS)

Measuring range 0 - 750V DC or AC

Autorange facility 4V / 40V / 400V / 750V

Resolution 1mV in 4V range
10mV in 40V range
100mV in 400V range
1V in 750V range

Accuracy

RMS and DC

V > 1V $\pm 1\%$ rdg ± 5 dgts

V < 1V $\pm 0.02\text{V}$

AV

V > 1V $\pm 3\%$ rdg ± 5 dgts

V < 1V $\pm 0.03\text{V}$

Pk

V > 1V $\pm 5\%$ rdg ± 5 dgts

V < 1V $\pm 0.03\text{V}$

CF (Crest Factor)

$1 \leq \text{CF} < 3$ $\pm 3\%$ rdg ± 5 dgts

$3 \leq \text{CF} < 5$ $\pm 5\%$ rdg ± 5 dgts

Resolution 0.01

RPL (Ripple)

$2\% \leq \text{RPL} < 100\%$ $\pm 3\%$ rdg ± 5 dgts

$100\% \leq \text{RPL} < 600\%$ $\pm 5\%$ rdg ± 5 dgts

Resolution 0.1%

$V_{\text{DC}} > 0.5\text{V}$, $V_{\text{AC}} > 0.2\text{V}$

All measurements DC and 10Hz to 1kHz. Maximum overload 1,000 V RMS. Volts RMS is a true RMS measurement (AC + DC)

Harmonics

THD (Total Harmonic Distortion)

$1\% \leq \text{THD} < 100\% \dots \pm 3\% \text{ rdg} \pm 5 \text{ dgts}$

$100\% \leq \text{THD} < 600\% \dots \pm 5\% \text{ rdg} \pm 5 \text{ dgts}$

Resolution 0.1%

DF (Distortion Factor)

$1\% \leq \text{DF} < 100\% \dots \pm 3\% \text{ rdg} \pm 5 \text{ dgts}$

Resolution 0.1%

$H_{01} \leq V_{\text{harm}} < H_{13} \dots \pm 5\% \text{ rdg} \pm 2 \text{ dgts}$

$H_{13} \leq V_{\text{harm}} \leq H_{25} \dots \pm 10\% \text{ rdg} \pm 2 \text{ dgts}$

All measurements up to 25th harmonic.

Frequency range F_0 45Hz to 65Hz

$V_{\text{acrms}} > 1V$, $V_{\text{harm}} > 10\% V_{\text{acrms}}$

5.1.3 Watts measurement (Single and 3 Phase)

(DC, DCRMS, ACRMS)

Measuring range 0 - 1200kW DC or
850kW AC

Autoranging facility 4kW, 40kW, 400kW,
1200kW

Resolution 1W in 4kW

10W in 40kW

100W in 400kW

1kW in 1200kW

Accuracy 2.5% rdg ± 5 dgts

$W_{1\phi} < 2kW \dots \pm 0.08 \text{ kW}$

$W_{3\phi} < 4kW \dots \pm 0.25 \text{ kW}$

5.1.4 VA measurement (Single and 3 Phase)

(DC, DCRMS, ACRMS)

Measuring range 0-1200kVA DC or
850kVA AC

Autorange facility 4kVA, 40kVA, 400kVA,
1200kVA

Resolution 1VA in 4kVA

10VA in 40kVA

100VA in 400kVA

1kVA in 1200kVA

Accuracy

$VA > 2kVA \dots \pm 2.5\% \text{ rdg} \pm 5 \text{ dgts}$

$VA < 2kVA \dots \pm 0.08 \text{ kVA}$

5.1.5 VAR Measurement (Single and 3 Phase)

Measuring range 0 - 850kVAR

Autorange facility 4kVAR, 40kVAR,
400kVAR, 850kVAR

Resolution 1VAR in 4kVAR

10VAR in 40kVAR

100VAR in 400kVAR

1kVAR in 850kVAR

Accuracy

$VAR > 4kVAR \dots \pm 2.5\% \text{ rdg} \pm 5 \text{ dgts}$

$VAR < 4kVAR \dots \pm 0.25 \text{ kVAR}$

Power Factor range $0.3 < \text{PF} < 0.99$

5.1.6 Power Factor (Single and 3 Phase)

Measuring range 0.3 cap ... 1.0 ... 0.3 ind
(72.5° cap ... 0° ... 72.5° ind)

Resolution 0.01

Accuracy $\pm 3^\circ$

5.1.7 Kilowatt Hour (kWhr)

Measuring range 40,000kWhr

Autorange facility 4kWhr, 40kWhr,
400kWhr,

4,000kWhr, 40,000kWhr

Resolution 1Whr in 4kWhr

10Whr in 40kWhr

100Whr in 400kWhr

1kWhr in 4,000kWhr

10kWhr in 40,000kWhr

Accuracy

$kWhr > 2kWhr \dots \pm 3\% \pm 5 \text{ dgts}$

$kWhr < 2kWhr \dots \pm 0.08 \text{ kWhr}$

All measurements

Frequency range DC and 10Hz to 1kHz

Current range 10A to 1400A RMS

Voltage range 1V to 600V RMS

Maximum input 600V RMS / 2000A Pk

Maximum overload 1000V RMS / 10,000A

5.1.8 Frequency measurement

(From Current or Voltage sources)

Measuring range 10Hz to 1kHz

Resolution 0.1Hz

Accuracy

40 - 70Hz $\pm 0.5\%$ rdg

10 - 1000Hz $\pm 1\%$ rdg

Current Range 10A to 1400A RMS

Voltage Range 1V to 600V RMS

5.1.9 Scope Function

5.1.9.1 Current measurement

Ranges 10A/20A/40A/100A/200A/
400A/1000A/2000A

Resolution 1A in 40A

10A in 400A

50A in 2000A

Accuracy $\pm 3\%$ rdg ± 1 pixel

Maximum overload 10,000A

5.1.9.2 Voltage measurement

Ranges 4V/10V/20V/40V/100V
200V/400V/1000V

Resolution 100mV in 4V

1V in 40V

10V in 400V

31.25V in 1000V

Accuracy $\pm 2\%$ rdg ± 1 pixel

Maximum overload 1000V RMS

Frequency range DC and 10Hz to 600Hz

Time base 2ms, 4ms, 10ms, 50ms/div

Refresh rate 0.5 seconds

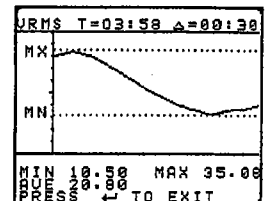
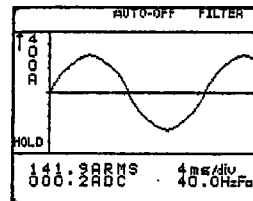
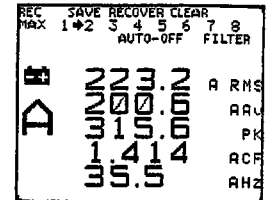
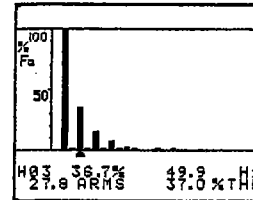
5.1.10 Digital output

RS-232 Interface to a PC. 9600 baud 1 start bit 8 data bits 1 stop bit. Requires PowerLog interface and software

5.2 General Data

5.2.1 Display

Backlit dot matrix LCD 160 x 128.



5.2.2 Power Supply

Battery type 1.5V Alkaline AA MN 1500 or IEC LR6 x 6

Battery life typically:

24 hours (backlight off)

12 hours (backlight on)

5.2.3 Environmental

FOR INDOOR USE ONLY

Reference conditions. All accuracies stated at $23^{\circ}\text{C} \pm 1^{\circ}\text{C}$

Operating temperature 0°C to 50°C (32°F to 122°F)

Temperature coeff. of current $\leq \pm 0.15\%$ of rdg per $^{\circ}\text{C}$

Temperature coeff. of voltage $\leq \pm 0.15\%$ of rdg per $^{\circ}\text{C}$

Maximum relative humidity 80% for temperatures up to 31°C (87°F) decreasing linearly to 50% relative humidity at 40°C (104°F)

Maximum operating altitude 2000m

5.2.4 Mechanical

Dimensions Length 300mm (12 inches)

Width 98mm (3.75 inches)

Depth 52mm (2 inches)

Weight inc. batteries 820g / 1.8lbs.

Case material Bayblend T85MN

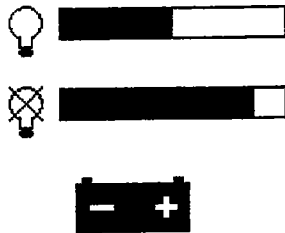
Jaw opening 60mm

Jaw capacity 58mm diameter

- Accessories..... Voltage probes
 Carrying case
 Operator's manual
- Cleaning The unit can be cleaned with an Isopropanol impregnated cloth. Do not use abrasives or other solvents.

5.2.5 Power-up

At power-up the following screen is displayed for 5 seconds indicating the battery status. The remaining battery lifetime is displayed, with and without the backlight. When the display changes to the digital mode, the instrument is ready for use.



6. ACCESSORIES

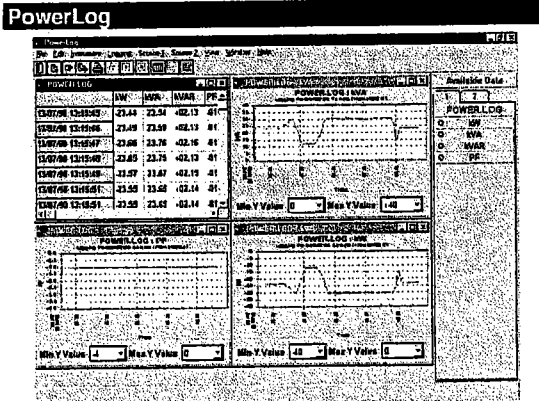


Fig. 7 PowerLog Software

PowerLog is the PC resident software for the Megger DCM2000P. The software is used to continually log electrical power measurements or download stored data from the instrument to a Personal Computer for further analysis

Key features include:

- Easy to use Windows™ format
- Data presentation in display mimic, table and chart modes
- Waveform, harmonics and data download
- Harmonics analysis of waveforms
- Logging of up to 5 parameters, waveforms and harmonics
- Simple exporting of data and trends into other applications

7. WARRANTY

Your Megger DCM2000P clamp on power meter is guaranteed for one year from the date of purchase against defective material or workmanship. If the meter fails during the warranty period, we shall at our discretion, repair or replace it with a new or reconditioned unit provided we are satisfied that the failure is due to defective material or workmanship.

To make a claim under warranty, the meter should be returned to us, postage prepaid, with a description of the defect. The use of batteries, other than that specified invalidates this warranty.

Goods alleged by the buyer to be defective shall not form the subject of any claim for injury, loss, damage, or any expense howsoever incurred whether arising directly or indirectly from such alleged defects other than death or personal injury resulting from the seller's negligence.

No condition is made or to be implied nor is any warranty given or to be implied as to the life or wear of goods supplied or that they will be suitable for any particular purpose or for use under specific conditions, notwithstanding that such purpose or conditions may be made known to the seller.

AVO International Ltd policy is one of continuous product improvement and the company reserves the right to revise the above specifications without notice.