

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Range Rover

Bulletin N°: 0032
CDS. ref: L8655bu
Issue: 1
Date: 23.05.01


AFFECTED RANGE:
All vehicles up to VIN 1A 455643

PROBLEM:
SIDE REPEATER LAMP ADRIFT FROM FRONT WING

CAUSE:
Failure of the repeater lamp retaining clip.

ACTION:
On customer complaint of poor side repeater lamp retention on a vehicle prior to the above VIN, replace the faulty unit with improved part XGB100280.

NOTE: XGB100280 has a clear lens.
If the lamp to be replaced has an amber lens, replace both lamps and fit new bulbs XZQ100210L.

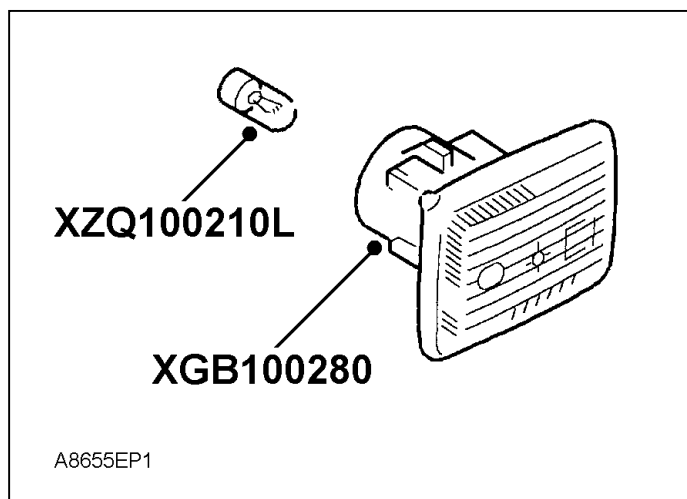

PARTS INFORMATION:
XGB100280 Lamp - side repeater
XZQ100210L Bulb - side repeater lamp

WARRANTY CLAIMS:
Use Complaint Code: 7J4B

Use S.R.O.: 86.40.51 Lamp - side repeater - one side or both - renew
Time allowance: 0.10Hrs